

METHOD 'A'
REPAIRS PERFORMED AT AN EXISTING TRANSVERSE JOINT EVEN
THOUGH ONLY ONE SIDE NEEDS REPAIR. THE TOTAL REPAIR
LENGTH SHALL BE 6' CENTERED ON THE ADJACENT
TRANSVERSE JOINT.

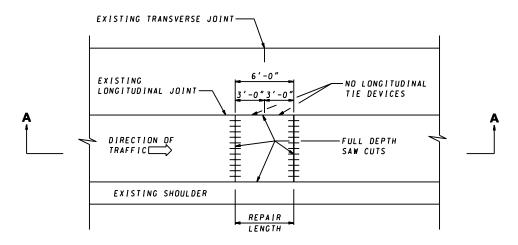

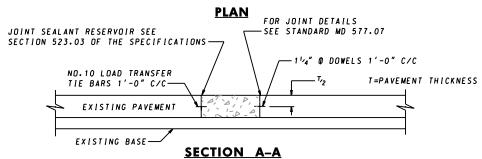

REPAIR GUIDELINES

SPECIFICATION CATEGORY CODE ITEMS

- 1. TYPE 1 REPAIRS ARE 6 FT TO LESS THAN 15 FT IN LENGTH AND REOUIRE NO REINFORCEMENT. (PLAIN CONCRETE)
- 2. REPAIR SLABS AND REMAINS OF EXISTING SLABS SHALL NOT BE LESS THAN 6 FT IN LENGTH.
- 3. EXISTING DOWELS AND ASSEMBLIES SHALL BE COMPLETELY REMOVED WHEN A REPAIR IS PERFORMED AT A TRANSVERSE JOINT.
- 4. ALL REPAIRS OFFSET MORE THAN 3 FT ON EITHER SIDE OF AN EXISTING TRANSVERSE JOINT SHALL BE EXTENDED TO A MINIUM OF 6 FT AND DOWEL ASSEMBLIES SHALL BE PLACED ADJACENT TO THE EXISTING TRANSVERSE JOINTS AS SHOWN IN REPAIR METHOD 'C' ON STANDARD MD 577.04.

NOTES

- 1. REPAIRS SHALL BE MADE IN ACCORDANCE WITH SECTION 522 OF THE SPECIFICATIONS.
- 2. REPAIRS SHALL BE MADE USING CONCRETE MEETING THE REQUIREMENTS OF SECTION 522.02 OF THE SPECIFICATIONS.
- 3. SUBGRADE PERPARATION SHALL BE IN ACCORDANCE WITH SUBSECTION 522.03.04 OF THE SPECFICATIONS AND MAY REQUIRE ADDITIONAL MATERIAL TO FACILITATE PLACEMENT OF LOAD TRANSFER DEVICES.
- 4. HOLES FOR THE DOWELS AND LOAD TRANSFER TIE DEVICES SHALL BE DRILLED SIMULTANEOUSLY TO THE REQUIRED DEPTH USING FRAME MOUNTED DRILLS WHICH WILL MAINTAIN THE DRILLS IN A LONGTUDINALLY PARALLEL POSITION.
- 5. JOINTS SHALL BE MADE IN ACCORDANCE WITH SECTION 520 OF THE SPECIFICATIONS AND STANDARD MD 577.07.
- 6. ALL LOAD TRANSFER TIE BARS AND DOWELS SHALL BE EPOXY COATED.
- 7. SEE STANDARD MD 577.01 FOR PAVEMENT REPAIR SAW CUTS FOR LIFT OUT METHOD.

522	CATEGORY CODE HEMIS		Maryland Department of Transportation
APPROVED	APPROVED Kik G. Mª CULL DIRECTOR - OFFICE OF HIGHWAY DEVELOPMENT		STATE HIGHWAY ADMINISTRATION STANDARDS FOR HIGHWAYS AND INCIDENTAL STRUCTURES METHOD 'A' PLAIN
	APPROVAL • SHA REVISIONS APPROVAL 3-6-86	APPROVAL • FEDERAL HIGHWAY ADMINISTRATION APPROVAL 3–18–86	
State High way	REVISED 10-1-01 REVISED REVISED	REVISED 4-26-89 REVISED REVISED	STANDARD NO. MD 577.02